

25202600165R

	
Guangdong ShengGe Sanitary Ware Technology Co.,Ltd. DINGHOUPAN, HENGXI VILLAGE, GUXIANG TOWNW, CHAO' AN DISTRICT, CHAOZHOU CITY,Guangdong , China	
26 2303A PH	EN 997 — CL 1 – 6A

COMPREHENSIVE TECHNOLOGY CENTRE OF FOSHAN CUSTOMS

CERTIFICATE Of Conformity

Certificate No: 25202600165R

Applicant: Guangdong ShengGe Sanitary Ware Technology Co.,Ltd.

Address of Applicant: DINGHOUPAN, HENGXI VILLAGE, GUXIANG TOWNW, CHAO' AN DISTRICT, CHAOZHOU CITY, Guangdong , China

Product: WALL HUNG TOILET

Brand: INSPIRE

Type designation: 2303A, 2382A, 2303, 2380, 2381, 2380A, 2380AT, 2381A, 2381AB, 2386A, 2392A, 2303AS, 2305AS, 2380AS, 2381AS, 2392AS

Technical data: Wall-hung WC pan with integral trap, personal hygiene, Type 1, nominal flush volume of 6L

The submitted samples of the above product have been tested for CE marking according to the following European Directives:

(EU)No.305/2011-the Construction Products Regulation

Standard used for showing compliance with the essential requirements in the specified directive:


Standard	Test report	Issued by	Date
EN 997:2018	25202600165R	CTC of FOSHAN CUSTOMS	Mar. 23, 2026

The referred test report shows that the product complies with standard recognized as giving presumption of compliance with the essential requirements in the specified EU Directive.

After preparation of the necessary technical documentation as well as the conformity declaration the CE marking as shown below can be affixed on the product. Other relevant Directives have to be observed.

This document is the property of Comprehensive Technology Centre of Foshan Customs, and it is not transferable. Only the applicant may reproduce this certificate.

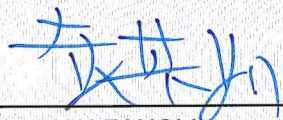


YUAN FANGLI
Director



Issue Date: Mar. 23, 2026

Expiration Date: Mar. 22, 2029

Note: 1. This certificate is part of the full report and should be read in conjunction with it.
2. This report supersedes report No. 25202600165

COMPREHENSIVE TECHNOLOGY CENTRE OF FOSHAN CUSTOMS
1ST FLOOR, NO.25-1, SHIDONGXIA ROAD, CHANCHENG DISTRICT, FOSHAN CITY, GUANGDONG PROVINCE
TEL: 86-757-83827991

TEST REPORT

REPORT No. : 25202600165R

SAMPLES: WALL HUNG TOILET

APPLICANT: Guangdong ShengGe Sanitary Ware
Technology Co.,Ltd.

DATE OF TEST: 19/03/2026—23/03/2026 (DD/MM/YYYY)

STATE KEY TESTING LABORATORY OF BUILDING CERAMICS AND SANITARY WARE
COMPREHENSIVE TECHNOLOGY CENTRE OF FOSHAN CUSTOMS



TEST REPORT

Report No.: 25202600165R

Page 2 of 5

Name of Sample	WALL HUNG TOILET	Type	INDEPENDENT WC PAN, WALL-HUNG, SINGLE FLUSH, TYPE 1, NOMINAL FLUSH VOLUME OF 6L
Mark of Samples	2303A	Description of Samples	The samples are sound, intact and fit for test.
Quantity of Samples	1 Set	Nominal Size	525mm×345mm×360mm
Applicant	Guangdong ShengGe Sanitary Ware Technology Co.,Ltd.	Address of Applicant	DINGHOUPAN, HENGXI VILLAGE, GUXIANG TOWNW, CHAO' AN DISTRICT, CHAOZHOU CITY,Guangdong , China
Telephone of Applicant	—	Fax of Applicant	—
Source of Samples	Sample selected by applicant	Received on	17/03/2026
Test Standard	EN 997:2018 <i>WC pans and WC suites with integral trap</i>		
Conclusion of Test	The results conform to the requirements of EN 997: 2018 with respect to the test items.		
Stamp of Test Unit	 Date: 23/03/2026	Address of Test Unit	Address: 1 ST FLOOR, NO.25-1, SHIDONGXIA ROAD, CHANCHENG DISTRICT, FOSHAN CITY, GUANGDONG PROVINCE Tel: 86-757-83827991 E-mail: fsiqtc@163.com
Possible test case verdicts	1. P(ass) : test item does meet the requirement. 2. N/A : test case does not apply to the test item. 3. F(ail) : test item does not meet the requirement. 4. —: verdict/test was not carried out.		

Tested by 张玲 Inspected by 肖景 Approved by 李林

TEST REPORT

Report No.: 25202600165R

Page 3 of 5

Remark of applicant

The test report data was based on item No. 2303A, in a family of wall hung toilet. All items in the family are same in water absorption, material, method of manufacture and finish surface characteristics, except for the design of appearance.

Items in the family:

2303A, 2382A, 2303, 2380, 2381, 2380A, 2380AT, 2381A, 2381AB, 2386A, 2392A, 2303AS, 2305AS, 2380AS, 2381AS, 2392AS

Brand: INSPiRE

Photo of Samples



2303A

TEST REPORT

Report No.: 25202600165R

Page 4 of 5

EN 997:2018 WC pans and WC suites with integral trap				
Clause	Properties	Requirements	Results	Verdicts
5.1	Depth of water seal	≥ 50 mm	51mm	Pass
5.2	Flushing requirements			
	Wash of bowl	The arithmetic average of any unflushed area below the rim and above the surface of the water in the trap shall not be more than 50 cm ² after five flushing operations.	No sawdust remaining	Pass
	Flushing of toilet paper	12 sheets of toilet paper shall be flushed out of the WC pan a minimum of 4 times out of five tests.	Compliant	Pass
	Flushing of fifty small plastic balls	Each with 50 balls, a minimum of 85% of the balls shall be flushed out of the WC pan.	—	N/A
	Over splashing	Flushing water shall not splash beyond the rim of the bowl and wet the floor. Only a few small drops are permissible.	Compliant	pass
	After-flush volume	An after-flush volume of 2.5L or 2.8L as appropriate is required.	2.9L~3.2L	Pass
5.3	Water absorption	Average: $E \leq 0.5\%$	Average: 0.06%	Pass
5.4	Static load	Wall-hung and non-ceramic WC pans and suites shall withstand a force of (4.00 ± 0.05) kN without showing any evidence of cracking or permanent deformation.	No cracking or permanent deformation	Pass
5.8	Sub-types of independent WC pans, close-coupled suites and one-piece WC pans			
5.8.1	Nominal flush volume	5.9L~6.0L	6.0L	Pass

*** **

End of the Page

TEST REPORT

Report No.: 25202600165R

Page 5 of 5

Disclaimer

1. All tests are carried out conscientiously to the best of our knowledge and ability. This report does not in any respect absolve the other related parties from their contractual and legal obligations.
2. This report shall not be reproduced, except in full, without the prior written approval from the issuing laboratory.
3. The results in this report apply to the samples only.
4. The product information is declared by applicant, and laboratory is not responsible for the authenticity.
5. The cover and declaration page of the report are integral parts of the test report.
6. This laboratory is a multi-site laboratory with two testing sites under it:
Testing Location ①: 1st Floor, No.25-1, Shidongxia Road, Chancheng District, Foshan City, Guangdong Province
Testing Location ②: Nanhai Road North, Guicheng, Nanhai District, Foshan, Guangdong, China
7. To check the authenticity of the test report, please send an email to fsiqtc@163.com or contact us at telephone 0757-83960253.
8. This report supersedes report No. 25202600165

*** **

End of Test Report

